

[LANCIA](#) / [YPSILON](#) / [1.3 JTD](#) / [PROCEDURES](#) / [70 FITTINGS](#) / [7005 PASSENGER COMPARTMENT FRONT SIDE DOORS](#)

/ [7005C FRONT LOCK CONTROLS](#)

/ 7005C50 FRONT SIDE DOOR INTERIOR OPENING MECHNISM R-R FOR REPAIR OR REPLACEMENT WITH DOOR PANEL REMOVED


2429494 - 7005C50 front side door interior opening mechnism r-r for repair or replacement with door panel removed

 Removing ([Refitting](#) )


- [7005D14 front side door descending window glass - r r with door panel \(and mount frame\) removed](#)

- [7005A08 interior support frame of one side door r r with door panel removed](#)

1. Disconnect the idler device (1a) from the retainer (1b) for the interior opening handle.
2. Release the cable from the retainers.

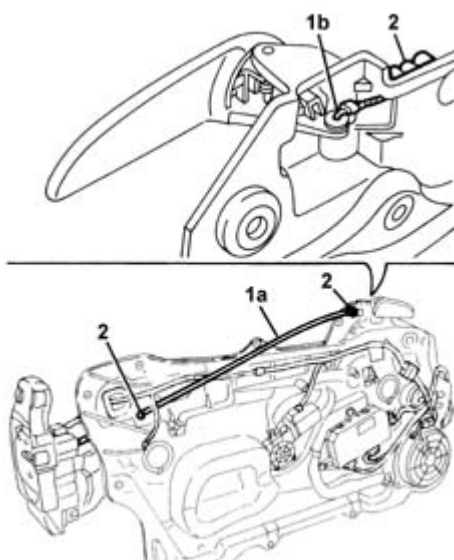

1. Release and open the anti-break in protection.
2. Remove the lock retainer access cover.
3. Release the idler device (3a) from the lock retainers (3b) and (3c).
4. Remove the idler device assembly.

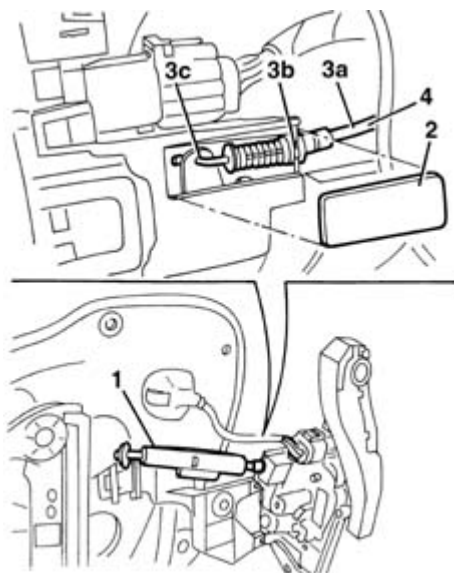

 Refitting ([Removing](#) )

Check that the return device is not damaged.

Position the device and attach it to the lock retainers.

Fit the cover.

Position the anti-break in protection correctly.

Attach the cable to the retainers.

Connect the idler device to the interior handle retainer.

- [7005A08 interior support frame of one side door r r with door panel removed](#)

- [7005D14 front side door descending window glass - r r with door panel \(and mount frame\) removed](#)