


[LANCIA](#) / [YPSILON](#) / [1.3 JTD](#) / [PROCEDURES](#) / [70 FITTINGS](#) / [7005 PASSENGER COMPARTMENT FRONT SIDE DOORS](#)
/ [7005N FRONT DOOR CENTRAL LOCKING SYSTEM](#)
/ 7005N20 FRONT SIDE DOOR LOCK MOTOR/CATCH ASSEMBLY - RR WITH DOOR PANEL AND SUPPORT FRAME REMOVED

2429517 - 7005N20 front side door lock motor/catch assembly - rr with door panel and support frame removed

 Removing ([Refitting](#) )

1. Release and open the anti-break in protection.
2. Remove the lock retainer access cover.
3. Release the idler device (3a) from the lock retainers (3b) and (3c).

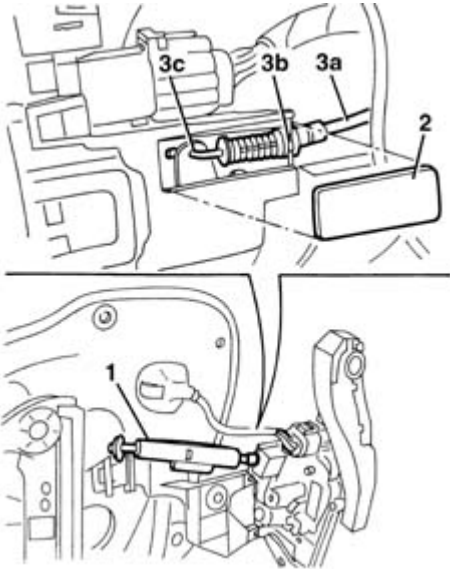


1. Disconnect the electrical connection for the loc,

	Name	Connector
1	Front driver's door lock geared motor.	N50

	Name	Connector
1	Front passenger door lock geared motor	N51

2. Release the retainers (2a) and remove the lock (2b).

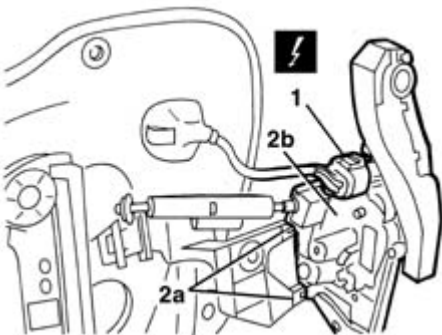

 Refitting ([Removing](#) )

- Check that the lock motor assembly is not damaged.
- Position the lock fitting the retainers.
- Connect the electrical connection.
- Position the idler device and attach it to the lock retainers.
- Fit the cover.
- Position the anti-break in protection correctly.